

Tech Tip **Atronic Emotion TFT Inverter Repair**

By **Ian Walker**

Date **November 2011**

PARTS AFFECTED

Distec 17" LCD panels for Atronic Emotion

PROBLEM DESCRIPTION

LCD backlight comes on briefly during startup or does not come on at all.

PROBLEM SOLUTION

Replace electrolytic Caps C1 and C2 on the Backlight inverter board.



PARTS REQUIRED

- C1 470uF 16v Electrolytic
- C2 470uF 16V Electrolytic